

TRANSPONDER IMMOBILISER USER INSTRUCTIONS

CYCLOPS
VEHICLE SOLUTIONS



TRANSPONDER IMMOBILISER

CYCLOPS
VEHICLE SOLUTIONS

Security System

CYCLOPS PARALYSER 205


User Instructions

Congratulations on having one of the world's most advanced and unique Australian designed and engineered vehicle security systems, installed in your vehicle!

**The Cyclops Paralyser 205 has been tested to and meets
Australian Standards 4601:1999.**

DISARMING

To disarm the P205, simply switch on the vehicle's engine. The small transponder tag attached to your key chain will come in close proximity to the receiver antenna located below the ignition switch. The P205 will decode the signal from the tag and disarm. The red status LED will extinguish and the engine can be started. If the engine is not started within 39 seconds the P205 will automatically re-arm.

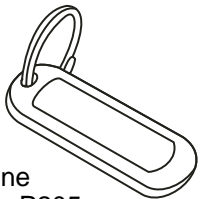

ARMING

The P205 will automatically arm within 39 seconds of the ignition being switched off.

ENGINE IMMOBILISATION

When the system is armed the engine is immobilised. The two independent, normally open circuits of immobilisation ensures the engine is starved of either fuel or spark. Immobilisation points vary from vehicle to vehicle; common engine kill places include fuel injection, fuel pump, fuel cut-off solenoids, main ignition feed, low-tension distributor supplies and starter motor solenoids etc.

OVERRIDE

The system can be overridden by means of a Personal Identification Number (PIN). Every unit is supplied with its own PIN. It is important to make a note of this PIN or keep the card supplied with the unit in a safe place as it also has the PIN detailed on it.

**** Any digit marked '0', indicates 10 flashes.**

OVERRIDE PROCEDURE

- Insert the ignition key into the ignition switch and turn to the ON position. The red status LED mounted on the dash will glow constantly.
- Turn the ignition key back to the ACC position, the status LED will begin to flash slowly. Count the number of flashes for the first digit in the PIN of the P205.
- Return the key to the ON position when the correct number is counted.
- Repeat step 2 for all remaining digits in the PIN. When all four digits are entered, the status LED will flash very quickly. If ignition is left in ON position for 15 seconds, the P205 will disarm. The status LED will extinguish.

PROBLEM SOLVING

System won't disarm (LED won't flash or extinguish)

- Make sure that ignition switch is in the OFF position.
- Make sure the vehicle battery is not flat.
- Try your spare transponder tag.
- Use PIN to over-ride and contact you nearest Cyclops service centre.

SPECIFICATIONS

Manufactured by	Dynamco Pty Ltd
Model Number	Paralyser 205
Standards met	AS/NZS 4601:1999
Supply voltage	+12VDC
Current consumption	less than 10mA (when armed)

ANNUAL INSPECTION

Dynamco prides itself on the durability and integrity of its car security systems. We welcome users to contact a Cyclops service centre every twelve months for an annual inspection. (Please note a charge may be levied for this inspection)

1st Inspection

Date: _____

Venue: _____

Comment: _____

Signed:

2nd Inspection

Date: _____

Venue: _____

Comment: _____

Signed:

WARRANTY

Subject to the conditions stated below, to be free from manufacturing defects and faulty material within the warranty period stated below.

CONDITIONS

- That the warranty registration has been completed in full at the time of purchase and / or installation and is produced when warranty service is sought.
- The warranty does not cover general maintenance such as cleaning of bonnet switches, door switches, light switches etc, nor replacement of consumable items such as pilot lamps or transmitter batteries.
- This warranty shall be null and void if: -
- The product has been repaired by any other person other than by an authorised Cyclops service centre.
- Should a defect become apparent within the warranty period Dynamco Pty Ltd will repair the product free of charge for parts and labour. Should a mobile service be required, a call-out charge may apply.
- The product has been altered or tampered with in any way or the serial number altered, defaced or removed.
- The defect has been caused by negligence by the owner or their agent.
- The product has not been operated correctly, installed by an authorised Cyclops installer or has been subjected to misuse or undue wear and tear.
- Siren, control module or any system part is damaged by water.

THE WARRANTY DOES NOT COVER THE FOLLOWING COSTS: -

- Transport of the product to and from Cyclops service centres.
- Insurance of the produce in transit to or from the Cyclops service centres.
- Cost of any service call where the product is found by Cyclops to be in good working order.

The benefits conferred by this warranty are in addition to all other rights and remedies, which the consumer has

WARRANTY REGISTRATION

PURCHASED FROM _____

OWNER'S NAME _____

TYPE OF VEHICLE _____

VEHICLE REGO _____

MODEL OF UNIT _____

DATE OF INSTALL' _____

WARRANTY PERIOD : CONTROL MODULE

TRANSPONDERS

AFTER HOURS EMERGENCY PHONE _____